

Buying an Aerostar? Make certain all Service Bulletins have been complied with.

Recent Service Bulletin - Compliance Checklist

06/01/00

Service Bulletin #600-118 05/01/91 **Models:** 601, 601P, 602P, & 700P

Part I - Installation of New Restricted Fuel Pump Vent Fittings in Engine Driven Fuel Pumps Immediate installation recommended.
Comply with AD-91-08-17 **Approximate Cost:** \$150.00

Service Bulletin #600-119 07/16/91 **Models:** See Service Bulletin

Part I - Inspect Life Limited Turbocharger Clamps for Defects Inspect upon every removal of turbocharger clamps, replace at 900 hours.
 Part II - Installation of New Inconel Turbocharger Clamps Immediate replacement recommended and relieves Part I requirements.
Approximate Cost: Part I = \$160.00 Part II = \$1,560.00

Service Bulletin #600-120 08/05/91 **Models:** Pre 1982

Part I - Installation of New Throttle, Propeller, and Mixture Control Cables **Replacement Mandatory** within next 100 hours of operation.
Approximate Cost: \$2,622.00

Service Bulletin #920 09/12/91 **Models:** 600, Non-turbocharged Aerostars

Part I - Repetitive Inspection of Engine Tailpipes Next regular inspection not to exceed 10 hours, and each 25 hours thereafter.
 Part II - Installation of Fire Detection System Immediate installation **Strongly Recommended**, and relieves Part I requirement.
 Part III - Not Applicable Not Applicable
Approximate Cost: Part I = \$160.00 Part II = \$1,550.00 Part III = N/A

Service Bulletin #920A 09/12/91 **Models:** 601, 601P, 602P, 700P

Part I - Repetitive Inspection of Engine Tailpipes Next regular inspection not to exceed 10 hours, and each 50 hours thereafter.
 Part II - Installation of Fire Detection System **Installation Mandatory** before further flight.
 Part III - Installation of New Inconel Engine Tailpipes Immediate replacement, **Strongly Recommended**, and relieves Part I requirements.
Approximate Cost: Part I = \$360.00 Part II = \$1,550.00 Part III = \$6,920.00

Not to be used as a complete Service Bulletin Compliance Checklist. Prices and Availability Subject to Change without Notice.



Service Bulletin #600-122 10/03/91 **Models:** All Aerostars

Part I - Inspect 60050 Series Control System Pushrods for Wear Next 100 hrs or annual inspection, whichever comes first and every 100 hrs thereafter.

Part II - Replace Control System Pushrods Worn Beyond Limits

Approximate Cost: Part I = N/A Part II = TBA

Service Bulletin #600-123 11/08/91 **Models:** All Turbocharged Aerostars

Part I - Inspection of Front Exhaust Assemblies, Except Inconel Within 50 hours time in service, and each 50 hours thereafter.

Part II - Removal/Inspection of Front Exhaust with 2000 hrs or More Every 100 hours time in service replace at 3000 hours.

Part III - Installation of New Inconel Front Exhaust Assemblies Immediate replacement recommended and relieves Part I & II requirements.

Approximate Cost: Part I = \$40.00 Part II = \$320.00 Part III = \$6,900.00

Service Bulletin #746C 09/15/92 **Models:** All Aerostars

Part I - Repetitive Inspection of Main Gear Torque Links Within next 10 hours of operation, replace if cracked, replace within 100 hours.

Part II - Installation of New Main Gear Torque Links Install within next 100 hours of operation, and relieves Part I requirements.

Approximate Cost: Part I = \$160.00 Part II = \$1,540.00

Service Bulletin #600-126 12/07/92 **Models:** All Aerostars

Part I - Alteration of Existing Wing Fuel Tank Vent System Next 100 hours or Annual Inspection after receipt of Service Bulletin.

Approximate Cost: Part I = \$1,195.00

Service Bulletin #600-127 01/18/94 **Models:** All Turbocharged Aerostars

Part I - Installation of Wastegate Actuator Oil Filters Next 100 hours or Annual Inspection after receipt of Service Bulletin.

Approximate Cost: Part I = \$995.00

Service Bulletin #600-128 01/10/94 **Models:** All Aerostars with Wiebel Nose Gear Systems

Part I - Installation of New Nose Gear Lower Drag Brace Link Assembly Within next 10 hrs of operation or at next 100 hr inspection, whichever comes first.

Approximate Cost: Part I = \$1,795.00

Service Bulletin #600-129A 01/16/95 **Models:** All Turbocharged Aerostars

Part I - Replacement of Turbocharger Oil Supply Relief Valves and Outlet Fittings Within next 10 hours of operation.

Part II - Pre-Oiling Check of Turbocharger System

Approximate Cost: Part I = \$565.00 Part II = N/A

Not to be used as a complete Service Bulletin Compliance Checklist. Prices and Availability Subject to Change without Notice.



Service Bulletin #600-130 09/26/95 **Models:** All Aerostars

Part I - Inspection of Fuselage Horizontal Stabilizer Attach Fittings Within next 25 hours of operation and at each Annual Inspection.

Approximate Cost: Part I = \$75.00, *Inspection Labor Only*

Service Bulletin #600-131A 01/16/95 **Models:** All Turbocharged Aerostars

Part I - Replacement of Turbocharger Oil Scavenge Pumps Within next 25 hours of operation.

Approximate Cost: Part I = \$5,150.00

Service Bulletin #600-132 09/03/97 **Models:** All Aerostars

Part I - Inspection of 55% Upper Spar Cap Within next 25 hours of operation and at each Annual Inspection.

Approximate Cost: Part I = \$75.00, *Inspection Labor Only*

Service Bulletin #600-133R1 07/06/98 **Models:** All Aerostars

Part I - Inspection of Aileron Bell Cranks Within next 10 hours of operation.

Part II - Replacement of Fasteners At next 100 hour Annual Inspection.

Approximate Cost: Part I = \$55.00 Part II = \$720.00

Service Bulletin #600-134A 03/31/00 **Models:** All Aerostars

Part I - Inspection of Sides Braces Prior to Flight Prior to each flight until replacement.

Part II - Replacement of Side Braces Within next 50 hours of operation.

Approximate Cost: Part I = \$55.00 Part II = \$1,682.00

Service Bulletin #600-135 11/30/99 **Models:** All Aerostars

Part I - Inspection of Wing Fuel Pipe Assembly Within 100 hours in service after receipt of this Service Bulletin or at next Annual Inspection, whichever comes first and at 500 hour intervals.

Approximate Cost: Part I = \$240.00

Service Bulletin #600-136 03/31/00 **Models:** All Aerostar PA-60 Models of All Serial Numbers thru Airframe 1026 (Aircraft manufactured prior to 1985.)

Part I - Inspection of Wing Attach Fittings Within the next 50 hours and at each Annual Inspection thereafter.

Approximate Cost: Part I = \$240.00

Not to be used as a complete Service Bulletin Compliance Checklist. Prices and Availability Subject to Change without Notice.

